# **DDAS Accident Report**

#### **Accident details**

Report date: 11/08/2006 Accident number: 432

Accident time: 13:05 Accident Date: 30/10/2002

Where it occurred: MF ID 1000552, na Country: Bosnia Herzegovina

lokaciji Prebisali?i-Kratine-Srbinje

Primary cause: Other (?) Secondary cause: Other (?)

Class: Other Date of main report:

ID original source: BiH MAC Name of source: [Name removed]

Organisation: [Name removed]

Mine/device: PROM-1 AP Bfrag Ground condition: grass/grazing area

woodland

Date record created: 11/08/2006 Date last modified: 11/08/2006

No of victims: 1 No of documents: 1

#### Map details

Longitude: Latitude:

Alt. coord. system: Not currently available Coordinates fixed by:

Map east: Map north:

Map scale: Map series:

Map edition: Map sheet:

Map name:

#### **Accident Notes**

safety distances ignored (?)

inadequate investigation (?)

### **Accident report**

A BiH MAC incident report was made available It will be included when funds are found for a translation.

From the accompanying photographs, some details of the accident are inferred. From the report, some information is gleaned, such as the fact that PROM-1 and PMA-3 mines were anticipated.

"...[The victim] aktivirao minu PROM-1" There appear to have been seven deminers with 15-20 metres of the explosion.

The investigation occurred on 31st October 2002 (date of photographs).



Photographs show the victim appeared to land on top of the marking tape. The area was a grassed incline alongside a wooden picket fence with woodland behind.

Photographs are confusing. A mature tree (45cm diameter approx) may have caused an obstruction in the clearance lane. Certainly a box around the tree was left, and parts of the victim were photographed on the marking for the edge of that box.



A photograph of the crater was present with the PROM circle easily seen, although the baseplate had not been recovered.

The photograph alongside appears to show the start of a lane and the deminer's red basestick, with the crater in front of the basestick. From this it is inferred that the victim initiated the mine in front of the marking.



The victim suffered severe foot damage from which an amputation is inferred.

Photographs of unidentified flesh were also taken. Given the PROM-1s ferocity, death may be presumed.

[This record will be replaced by a translation as soon as possible.]

### **Victim Report**

Victim number: 575 Name: [Name removed]

Age: Gender: Male

Status: deminer Fit for work: DECEASED

Compensation: Not made available Time to hospital: Not recorded

Protection issued: Not recorded Protection used: Not recorded

#### Summary of injuries:

**INJURIES** 

severe Leg

**FATAL** 

COMMENT

No medical report was made available.

## **Analysis**

The original Board of Inquiry accident report is held on file and awaits formal translation. In the meantime, details of this accident are inferred largely from photographs.

Funding for formal translations is being sought.